

Series WE02 3-Piece Stainless Steel Ball Valve

Specifications - Installation and Operating Instructions



The SERIES WE02 incorporates a full port 3-piece SS ball valve for great flow rate with minimal pressure drop. The valve features a blowout proof stem for added safet reinforced PTFE seats and seals for longer life, and a 316 SS (ASTM CF8M) ball for better performance. Actuators are direct mounted creating a compact assembly for tight spaces. Limit switches are able to be mounted directly to the valves allowing for remote position indication.

The Series WE02 can be configured with either an electric or pneumatic actuate Electric actuators are available in weatherproof or explosion-proof, a variety of suppl voltages and two-position or modulating control. Two-position actuators use the supp voltage to drive the valve open or close, while the modulating actuator accepts a 4 20 mA input for valve positioning. Actuators feature thermal overload protection an permanently lubricated gear train.

The pneumatic double acting actuator uses an air supply to drive the valve ope and closed. The actuator has two supply ports, with one driving the valve open an the other driving the valve closed. Spring return pneumatic actuators use the a supply to open the valve, and internally loaded springs return the valve to the close position. Also available is the SN solenoid valve to electrically switch the air supp pressure between the air supply ports for opening and closing the valve. Actuato are constructed of anodized and epoxy coated aluminum for years of corrosion-free service.

es	SPECIFICATIONS	
ty,	VALVE	Electric "TD" and "MD" Series
for	Service: Compatible liquids and gases.	Power Requirements: 110 VAC,
for	Body: 3-piece.	220 VAC, 24 VAC or 24 VDC
for	Line Sizes: 1/2 to 3".	(MD models not available in 24 VDC).
	End Connections: Female NPT.	Power Consumption: See page 8.
	Pressure Limits: 28" Hg to 1000 psi	Cycle Time (per 90°): TD01: 4 s; MD01:
or.	(-0.7 to 69 bar).	10 s; TD02 and MD02: 20 s; TD03 and
ply	Wetted Materials: Body and ball: 316	MD03: 30 s.
ply	SS (CF8M); Stem: 316 SS; Seat: RTFE/	Duty Rating: 85%.
to	PTFE; Seal, Washer, and Packing:	Enclosure Rating: NEMA 4X (IP67).
nd	PTFE.	Housing Material: Powder coated
	Temperature Limits: -20 to 392°F	aluminum.
	(-29 to 200°C).	Temperature Limits: -22 to 140°F
en	Other Materials: O-ring:	(-30 to 60°C).
nd	Fluoroelastomer; Handle: 304 SS;	Electrical Connection: 1/2" female NPT.
air	Washer: 301 SS; Stem Nut, Locking	Modulating Input: 4 to 20 mA.
ed	Device, Gland Ring: 304 SS; Handle	Standard Features: Manual override,
ply	Sleeve: PVC.	position indicator, and TD models come
ors		with two limit switches.
ee	ACTUATORS	
	Pneumatic "DA" and "SR" Series	Electric "TI" and "MI" Series
	Type: DA series is double acting and SR	Power Requirements: 110 VAC,
	series is spring return (rack and pinion).	220 VAC, 24 VAC or 24 VDC.
	Normal Supply Pressure: DA: 40 to 115	Power Consumption: See page 9.
	psi (2.7 to 7.9 bar); SR: 80 psi (5.5 bar).	Cycle Time (per 90°): See page 9.
	Maximum Supply Pressure: 120 psi	Duty Rating: See page 9.
	(8.6 bar).	Enclosure Rating: NEMA 7.
	Air Connections: DA01: 1/8" female	Housing Material: Powder coated
	NPT; DA02 to DA05: 1/4" female NPT;	aluminum.
	SR02 to SR07: 1/4" female NPT.	Temperature Limits: -40 to 140°F
	Housing Material: Anodized aluminum	(-40 to 60°C).
	body and epoxy coated aluminum end	Electrical Connection: 1/2" female NPT.
	caps.	Modulating Input: 4 to 20 mA.
	Temperature Limits: -40 to 176°F (-40	Standard Features: Position indicator
	to 80°C).	and two limit switches.
	Accessory Mounting: NAMUR	
	standard.	


A DIVISION OF W.E. ANDERSON DWYER INSTRUMENTS, INC. P.O. BOX 373 • MICHIGAN CITY, INDIANA 46360, U.S.A.

Phone: 219/879-8000 Fax: 219/872-9057

www.dwyer-inst.com e-mail: info@dwyermail.com


MODE	MODEL CHART								
			Popular	Popular	Popular NEMA 4X	Popular NEMA 4X			
		Popular	Double Acting	Spring Return	Two Position	Modulating			
	Cv	Hand Operated	Pneumatic	Pneumatic	Electric	Electric			
Size	(gal/min)	Model	Model	Model	(110 VAC) Model	(110 VAC) Model			
1/2″	36.64	WE02-CHD00	WE02-CDA01	WE02-CSR02	WE02-CTD01-A	WE02-CMD01-A			
3/4″	67.69	WE02-DHD00	WE02-DDA01	WE02-DSR02	WE02-DTD01-A	WE02-DMD01-A			
1″	110.27	WE02-EHD00	WE02-EDA02	WE02-ESR03	WE02-ETD01-A	WE02-EMD01-A			
1-1/4″	184.73	WE02-FHD00	WE02-FDA02	WE02-FSR03	WE02-FTD01-A	WE02-FMD01-A			
1-1/2″	266.62	WE02-GHD00	WE02-GDA03	WE02-GSR04	WE02-GTD02-A	WE02-GMD01-A			
2″	485.3	WE02-HHD00	WE02-HDA03	WE02-HSR05	WE02-HTD02-A	WE02-HMD02-A			
2-1/2″	791.57	WE02-IHD00	WE02-IDA04	WE02-ISR07	WE02-ITD03-A	WE02-IMD03-A			
3″	1151.95	WE02-JHD00	WE02-JDA05	WE02-JSR07	WE02-JTD03-A	WE02-JMD03-A			


VALVE BILL OF MATERIALS

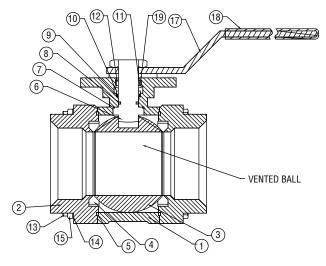

ltem	Description	Material
1	Body	ASTM A351-CF8M
2	Сар	ASTM A351-CF8M
3	Ball	ASTM A351-CF8M
4	Ball Seat	PTFE
5	Joint Gasket	PTFE
6	Stem	AISI 316
7	Thrust Washer	PTFE
8	Stem Packing	PTFE
9	High Washer	AISI 304
10	Belleville Washer	AISI 304
11	Stem Nut	AISI 304
12	O-Ring	Fluoroelastomer
13	Bolt	AISI 304
14	Spring Washer	AISI 304
15	Hex Nut	AISI 304
16	Stopper	AISI 304
17	Handle	AISI 304
18	Handle Cover	PVC
19	Lock Washer	AISI 304

VALVE DIMENSIONAL DRAWING

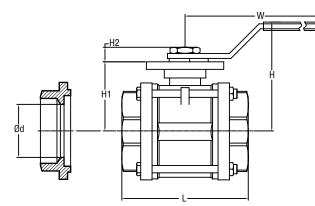

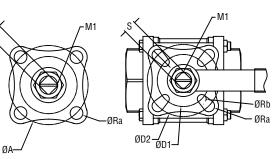

MODEL CHAR	т												
		Ød	L	н	W	S	ØD1	ØD2		ØRa	ØRb		Cv
Model	Size	in (mm)	in (mm)	in (mm)	in (mm)	in (mm)	in (mm)	in (mm)	ISO	in (mm)	in (mm)	M1	(gal/min)
WE02-CHD00	1/2″	19/32″	2-9/16″	2-3/8″	4-3/4″	23/64″	1-27/64″	1-21/32	F03/F04	7/64″	7/64″	M12x1.25	36.64
		(15)	(65)	(60)	(120)	(9)	(36)	(42)		(2.75)	(2.75)		
WE02-DHD00	3/4″	51/64″	2-61/64″	2-17/32″	4-3/4″	23/64″	1-27/64″	1-21/32	F03/F04	7/64″	7/64″	M12x1.25	67.69
		(20)	(75)	(64)	(120)	(9)	(36)	(42)		(2.75)	(2.75)		
WE02-EHD00	1″	63/64″	3-11/32″	2-59/64″	5-53/64″	7/16″	1-21/32″	1-31/32″	F04/F05	9/64″	7/64″	M14x1.5	110.27
		(25)	(85)	(74)	(148)	(11)	(42)	(50)		(3.5)	(2.75)		
WE02-FHD00	1-1/4″	1-17/64″	3-63/64″	3-1/8″	5-53/64″	7/16″	1-21/32″	1-31/32″	F04/F05	9/64″	7/64″	M14x1.5	184.73
		(32)	(101)	(79)	(148)	(11)	(42)	(50)		(3.5)	(2.75)		
WE02-GHD00	1-1/2″	1-1/2″	4-13/32″	3-3/4″	7″	9/16″	1-31/32″	2-49/64″	F05/F07	3/16″	9/64″	M18x1.5	266.62
		(38)	(112)	(95)	(178)	(14)	(50)	(70)		(4.5)	(3.5)		
WE02-HHD00	2″	2″	5-1/8″	4-1/16″	7″	9/16″	1-31/32″	2-49/64″	F05/F07	3/16″	9/64″	M18x1.5	485.3
		(50)	(130)	(103)	(178)	(14)	(50)	(70)		(4.5)	(3.5)		
WE02-IHD00	2-1/2″	2-1/2	3-3/8″	4-27/32″	7″	3/4″	2-49/64″	4-1/64″	F07/F10	Ø29/64″	Ø23/64″	M22x1.5	791.57
		(63)	(162)	(123)	(178)	(19)	(70)	(102)		(Ø11)	(Ø9)		
WE02-JHD00	3″	3″	7-13/32″	5-3/16″	7″	3/4″	2-49/64″	4-1/64″	F07/F10	Ø29/64″	Ø23/64″	M22x1.5	1151.95
		(76)	(188)	(131.5)	(178)	(19)	(70)	(102)		(Ø11)	(Ø9)		

S


-	E	- F
	00	
	°,°	B B

W/ PNEUMATIC ACTUATOR	
W/ PINEUWATIC ACTUATUR	


DOU	DOUBLE ACTING PNEUMATIC ACTUATOR								
NPT	1/2″	3/4″	1″	1-1/4″	1-1/2″	2″	2-1/2″	3″	
в	4-5/8″	4-3/4″	5-1/2″	5-3/4″	6-7/8″	7-1/4″	8-3/8″	9″	
	116 mm	120 mm	141 mm	146 mm	174 mm	184 mm	212 mm	228 mm	
С	2-3/8″	2-3/8″	2-3/4″	2-3/4″	3-1/4″	3-1/4″	3-3/4″	4″	
	61 mm	61 mm	71 mm	71 mm	82 mm	82 mm	94 mm	101 mm	
D	2-1/2″	3″	3-3/8″	4″	4-3/8″	5-1/8″	6-3/8″	7-3/8″	
	65 mm	75 mm	85 mm	101 mm	112 mm	130 mm	162 mm	188 mm	
E	4-5/8″	4-5/8″	5-3/4″	5-3/4″	6-5/8″	6-5/8″	7-7/8″	8-1/4″	
	116 mm	116 mm	145 mm	145 mm	169 mm	169 mm	201 mm	209 mm	
F	1-1/2″	1-1/2″	1-5/8″	1-5/8″	1-3/4″	1-3/4″	2″	2-1/8″	
	37 mm	37 mm	41 mm	41 mm	46 mm	46 mm	52 mm	55 mm	

SPRI	SPRING RETURN PNEUMATIC ACTUATOR								
NPT	1/2″	3/4″	1″	1-1/4″	1-1/2″	2″	2-1/2″	3″	
В	5″	5-1/8″	6-1/8″	6-3/8″	7-1/4″	7-7/8″	9-5/8″	10″	
	128 mm	132 mm	157 mm	162 mm	185 mm	201 mm	245 mm	253 mm	
С	2-3/4″	2-3/4″	3-1/4″	3-1/4″	3-3/4″	4″	4-3/4″	4-3/4″	
	71 mm	71 mm	82 mm	82 mm	94 mm	101 mm	122 mm	122 mm	
D	2-1/2″	3″	3-3/8″	4″	4-3/8″	5-1/8″	6-3/8″	7-3/8″	
	65 mm	75 mm	85 mm	101 mm	112 mm	130 mm	162 mm	188 mm	
Е	5-3/4″	5-3/4″	6-5/8″	6-5/8″	7-7/8″	8-1/4″	10-7/8″	10-7/8″	
	145 mm	145 mm	169 mm	169 mm	201 mm	209 mm	275 mm	275 mm	
F	1-5/8″	1-5/8″	1-3/4″	1-3/4″	2″	8-1/4″	10-7/8″	10-7/8″	
	41 mm	41 mm	46 mm	46 mm	52 mm	209 mm	275 mm	275 mm	

W/ ELECTRIC ACTUATOR

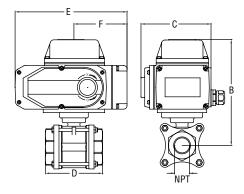

W/ EXPLOSION-PROOF ELECTRIC ACTUATOR

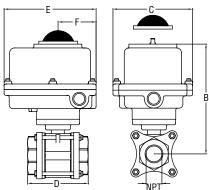

ELEC	CTRIC AC	TUATOR						
NPT	1/2″	3/4″	1″	1-1/4″	1-1/2″	2″	2-1/2″	3″
в	6-5/8″	6-3/4″	7-1/8″	7-3/8″	7-3/4″	8-1/8″	9-7/8″	10-1/8″
	169 mm	172 mm	182 mm	187 mm	197 mm	205 mm	250 mm	258 mm
С	4-1/2″	4-1/2″	4-1/2″	4-1/2″	4-1/2″	4-1/2″	4-3/4″	4-3/4″
	113 mm	113 mm	113 mm	113 mm	113 mm	113 mm	121 mm	121 mm
D	2-1/2″	3″	3-3/8″	4″	4-3/8″	5-1/8″	6-3/8″	7-3/8″
	65 mm	75 mm	85 mm	101 mm	112 mm	130 mm	162 mm	188 mm
E	6-1/4″	6-1/4″	6-1/4″	6-1/4″	6-1/4″	6-1/4″	7-3/4″	7-3/4″
	160 mm	160 mm	160 mm	160 mm	160 mm	160 mm	196 mm	196 mm
F	3″	3″	3″	3″	3″	3″	3-7/8″	3-7/8″
	77 mm	77 mm	77 mm	77 mm	77 mm	77 mm	98 mm	98 mm

EXPL	EXPLOSION-PROOF ELECTRIC ACTUATOR							
NPT	1/2″	3/4″	1″	1-1/4″	1-1/2″	2″	2-1/2″	3″
В	6-3/8″	6-1/2″	8-3/8″	8-1/2″	8-7/8″	10″	10-3/4″	11″
	162 mm	165 mm	211 mm	217 mm	227 mm	253 mm	272 mm	280 mm
С	5-1/4″	5-1/4″	9-3/8″	9-3/8″	9-3/8″	8-1/2″	8-1/2″	8-1/2″
	133 mm	133 mm	239 mm	239 mm	239 mm	216 mm	216 mm	216 mm
D	2-1/2″	3″	3-3/8″	4″	4-3/8″	5-1/8″	6-3/8″	7-3/8″
	65 mm	75 mm	85 mm	101 mm	112 mm	130 mm	162 mm	188 mm
E	6-1/8″	6-1/2″	8-1/2″	8-1/2″	8-1/2″	8-1/2″	8-1/2″	8-1/2″
	154 mm	154 mm	217 mm	217 mm	217 mm	216 mm	216 mm	216 mm
F	2-3/4″	2-5/8″	5″	5″	5″	5-3/8″	5-3/8″	5-3/8″
	68 mm	68 mm	126 mm	126 mm	126 mm	136 mm	136 mm	136 mm

PNEUMATIC ACTUATOR

Note: For optimal operation, pneumatic actuators should be run with a supply of clean, lubricated air.

Spring Return Actuator Operation

Air to PORT 2 (the left hand port) causes the actuator to turn counterclockwise (CCW). Loss of air to PORT 2 causes air to exhaust and the actuator turns clockwise (CW). This is the FAIL CLOSE operation.

Double Acting Actuators Operation

Air to PORT 2 (the left hand port) causes the actuator to turn counterclockwise (CCW). Air to PORT 1 (the right hand port) causes the actuator to turn clockwise (CW).

Pneumatic Actuator Maintenance

Routine maintenance of pneumatic actuator:

- · Keep the air supply dry and clean
- Keep the actuator surface clean and free from dust
- · Periodic checks should be done to make sure all fittings are tight

• Pneumatic actuators are supplied with lubrication to last the entire life span of the actuator under normal operating conditions.

The outer surface of the pneumatic actuator should be clean to avoid friction or corrosion. All fittings and connections should be tight to prevent leaks during operation. Check the bolts mounting the valve to the actuator to make sure they have not come loose during shipping or installation. Make sure the valve and actuator are not rubbing or jamming against other components during operation. The actuator should be inspected annually to make sure all fittings and bolts are tight and nothing has come loose during operation.

Disassembling Pneumatic Actuators

WARNING Before beginning disassembly, ensure that the air supply to the actuator has been disconnected, all accessories have been removed, and that the actuator has been disassembled from the valve.

1. Loosen the end cap fasteners (23) with a wrench (size varies depending on actuator model). On the spring return actuator, alternate 3 to 5 turns on each fastener until the springs are completely decompressed. Use caution when removing the cap since the springs are under load until the fasteners are fully extended.

2. Remove the pinion snap ring (13) with a lock ring tool. The indicator (12) may now be removed.

3. Turn the pinion shaft (2) counterclockwise until the pistons are at the full end of travel. Disengage the pistons (15) from the pinion. (NOTE: Low pressure air--3 to 5 psi MAXIMUM--might be required to force the pistons completely from the body.) Note the position of the pistons before removing them from the actuator body.

4. Remove the pinion through the bottom of the actuator. The actuator is now completely disassembled.

Failures	Inspection Items	Corrective Action
Pneumatic	1. Check the solenoid valve. Is the	1. Replace the solenoid
actuator	coil burnt out or is the solenoid	valve coil or remove debris.
won't operate	spool?	
	2. The actuator will not move	2. Disassemble the actuator,
	because of debris in the gears.	clean the debris and
		reassemble the actuator.
	3. The pneumatic line to the	3. Replace pneumatic line to
	actuator is distorted or smashed.	the actuator.
	4. The pneumatic line is frozen	4. Warm the pneumatic lines
	because of low temperatures and	and remove moisture from
	moisture.	supply lines.
Pneumatic	1. The air supply pressure is	1. Increase the air supply
actuator runs	insufficient.	pressure and look for leaks
slowly		in the supply pressure
		pipeline.
	2. Are other pneumatic devices	2. Increase the air supply
	consuming the air required for the	or reduce the number of
	actuator to operate?	devices operating at the
		same time.
	3. The pneumatic actuator is	3. Replace the actuator with
	undersized for the application.	a larger actuator.

Reassembling Pneumatic Actuators

G Be sure the actuator surfaces are free of debris and scratches before reassembling.

1. Apply a light film of grease to all O-rings and the pinion before replacing.

2. Put the pinion (2) back through the actuator with the flats of the pinion shaft running parallel with the body.


3. When reassembling the actuator, make sure that the piston racks are square to the actuator body and returned to their original orientation. (NOTE: The normal operation of all spring return pneumatic actuators is FAIL CLOSED. To change the orientation to FAIL OPEN, rotate the racks 180° to create a reverse operation.

4. When replacing springs in a spring return actuator, ensure that the springs are replaced in their identical position in the end cap from which they were removed. (NOTE: In some circumstances, you might want to change the standard 80 pound spring set to fit your application and available air pressure.

5. Seal the end caps with a petroleum lubricant and bolt to actuator body.

6. Check the seal of the actuator by covering seal areas (pinion, end caps) with soapy water and using low pressure air to the actuator to ensure that no bubbles are produced.

Pneumatic Actuators Bill of Materials

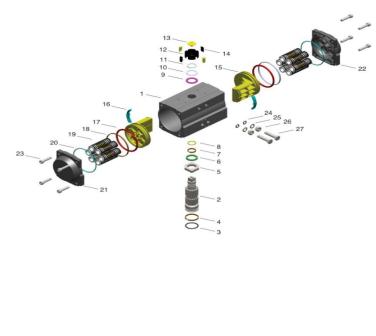

Part					
Number	Quantity	Part Name	Material		
1	1	Cylinder	Extruded Aluminum Alloy		
2	1	Output Shaft	Stainless Steel		
3	1	O-ring	Fluorine Silicon Rubber		
4	1	Bearing	Nylon46		
5	1	Adjusting Cam	Stainless Steel		
6	1	Thrust Bearing	Nylon46		
7	1	Bearing	Nylon46		
8	1	O-ring	Fluorine Silicon Rubber		
9	1	Bearing	Nylon46		
10	1	Gasket	Stainless Steel		
11	1	Damping Ring	Stainless Steel		
12	1	Position Indicator	PPPP+30%GF		
13	1	Screw	PPPP+30%GF		
14	4	Position Indicating	PPPP+30%GF		
		Inserts			
15	2	Piston	Casting Aluminum Alloy		
16	2	Guide Ring	Nylon46		
17	2	O-ring	Fluorine Silicon Rubber		
18	2	Guide Ring	Fluorine-Carbon Composite Material		
19	5 to 12	Spring Assembly	Alloy Spring Steel		
20	2	O-ring	Fluorine Silicon Rubber		
21	1	Left End Cap	Casting Aluminum Alloy		
22	1	Right End Cap	Casting Aluminum Alloy		
23	8	End Cap Bolt	Stainless Steel		
24	2	O-ring	Fluorine Silicon Rubber		
25	2	Gasket	Stainless Steel		
26	2	Nut	Stainless Steel		
27	2	Adjusting Bolt	Stainless Steel		

MODEL CH	MODEL CHART - DOUBLE ACTING ACTUATOR TORQUE								
	DA Double-Action Output Torque (Ib-in)								
	Air Pressure								
Model	40 psi	50 psi	60 psi	70 psi	80 psi	90 psi	100 psi	110 psi	115 psi
ACT-DA01	49	61	74	86	98	110	123	135	142
ACT-DA02	104	130	155	181	207	233	259	285	300
ACT-DA03	182	228	274	319	365	411	456	502	529
ACT-DA04	302	377	453	528	603	679	754	830	875
ACT-DA05	396	495	594	693	792	891	990	1089	1148
ACT-DA06	567	709	851	993	1135	1277	1419	1561	1649
ACT-DA07	845	1056	1267	1478	1690	1901	2112	2323	2450
ACT-DA08	1497	1871	2245	2619	2993	3367	3742	4116	4340
ACT-DA09	2253	2816	3379	3942	4506	5069	5632	6195	6533

MODEL CH	MODEL CHART - SPRING RETURN ACTUATOR TORQUE														
		SR Si	SR Single Acting Pneumatic Actuator (Ib-in)												
		Air Pr	essur	e											
		70 ps	i	80 ps	i	90 ps	i	100 p	si	110 p	si	115 p	si	Spring	Torque
	Spring	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°	0°	90°
Model	Quantity	Start	End	Start	End	Start	End	Start	End	Start	End	Start	End	Start	End
ACT-SR02	10	111	86	137	112	163	138	189	164	215	189	231	205	96	70
ACT-SR03	10	199	143	245	189	291	235	336	280	382	326	409	353	176	120
ACT-SR04	10	348	254	424	330	499	405	575	481	650	556	695	601	274	180
ACT-SR05	10	430	312	529	411	628	510	727	609	826	708	885	767	381	263
ACT-SR06	10	608	458	750	599	891	741	1033	883	1175	1025	1260	1110	536	386
ACT-SR07	10	783	663	994	874	1206	1085	1417	1297	1628	1508	1755	1635	817	696
ACT-SR08	10	1682	1208	2056	1583	2430	1957	2804	2331	3178	2705	3403	2930	1416	938
ACT-SR09	10	2303	1483	2866	2046	3429	2609	3992	3173	4556	3736	4894	4074	2363	1575
ACT-SR10	10	3479	2274	4337	3133	5195	3991	6053	4849	6911	5707	7426	6222	3549	2407

ELECTRIC ACTUATORS

Electric Installation

1. Operate valve manually and place in the open position.

2. Remove any mechanical stops the valve might have. (DO NOT REMOVE ANY PARTS NECESSARY FOR THE PROPER OPERATION OF THE VALVE, SUCH AS THE PACKING GLAND, PACKING NUT, ETC.)

3. Ensure that the actuator output shaft and valve stem are aligned properly. If they are not, operate the valve manually until they are correct.

4. Remove actuator cover.

Bring power to the actuator. CAUTION: Make sure power is OFF at the main box.
 Wire the actuator per the diagram attached to the inside of the cover. Special actuators (those with positioner boards, etc.) will have diagrams enclosed inside the cover.

7. Securely tighten bolts used to mount the actuator to a mounting bracket or directly to the valve mounting pad if it is ISO5211 compliant.

8. Cycle the unit several times and check the open and closed positions of the valve. Cams are pre-adjusted at the factory; due to the variety of valve designs and types however, slight adjustments might be required.

9. Replace cover and tighten screws.

To Set The Open Position

1. Cycle the valve to the open position by applying power to terminals. The top cam and switch control this position. In the open position, the set screw in the top cam will be accessible.

- 2. If the valve is not open completely:
- A. Slightly loosen the set screw on the top cam.
- B. Rotate the cam clockwise (CW) by hand until the switch makes contact. Contact is made when a slight click can be heard. By making incremental CW movements of the top cam, the valve can be positioned precisely in the desired position.

C. When the top cam is set, tighten the set screw securely.

3. If the valve opens too far:

 A. Apply power to terminals. This will begin to rotate valve CW. When valve is fully open and in the exact position desired, remove power from actuator.
 B. Loosen the set screw in the top cam.

C. Rotate the top cam counterclockwise (CCW) until the switch arm drops off the round portion of the cam onto the flat section. A slight click can be heard as the switch changes state.

D. Continue applying power to terminals until valve is in the desired position.

To Set The Closed Position

1. Apply power to terminals to move the valve toward the closed position. The bottom cam and switch control the closed position. In the closed position, the set screw in the bottom cam will be accessible.

- 2. If the valve is not closed completely:
- A. Slightly loosen the set screw on the bottom cam.

B. Rotate the cam counterclockwise (CCW) by hand until the switch makes contact. Contact is made when a slight click can be heard. By making incremental CCW movements of the bottom cam, the valve can be positioned precisely in the desired position.

C. When the top cam is set, tighten the set screw securely.

3. If the valve closes too far:


A. Apply power to terminals. This will begin to rotate valve CCW. When valve is fully closed and in the exact position desired, remove power from actuator.

B. Loosen the set screw in the top cam.


C. Rotate the top cam clockwise (CW) until the switch arm drops off the round portion of the cam onto the flat section. A slight click can be heard as the switch is no longer making contact with the round part of the cam.


D. Continue applying power to terminals until valve is in the desired position.


Wiring Diagrams for TI01-A to TI05-A: 110 VAC, TI01-B to TI05-B: 220 VAC, TI01-C to TI05-C: 24 VAC

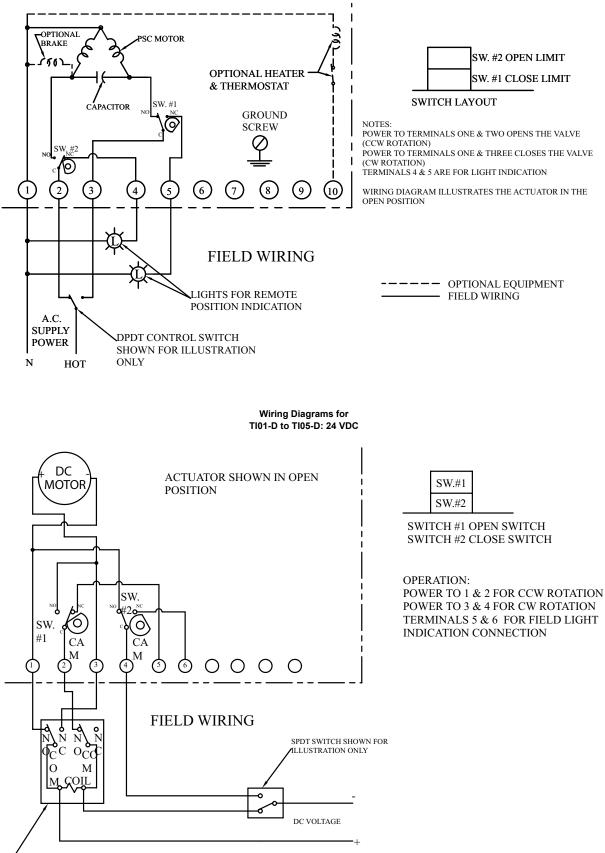


REVERSING RELAY SUPPLIED BY CUSTOMER




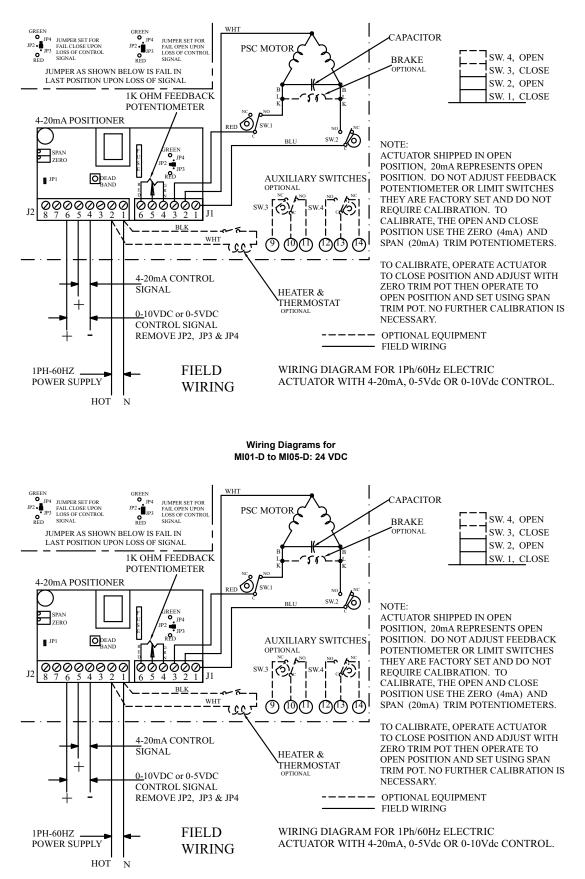




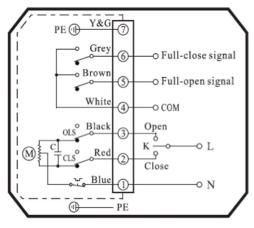

Wiring Diagrams for TD01-D to TD06-D: 24 VDC

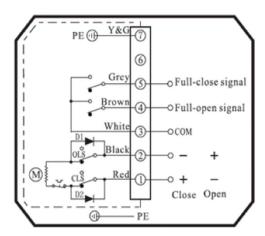

Wiring Diagrams for MD01-A to MD06-A: 110 VAC, MD01-B to MD06-B: 220 VAC, MD01-C to MD06-C: 24 VAC

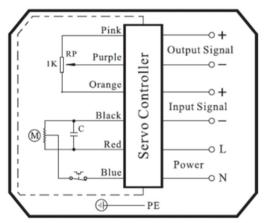

Note: To speed up installation of the control wires to the ACT-MDXX modulating actuator, it is recommended to remove the control module from the actuator. The control module can be removed by removing the two mounting screws on the left and right of the control module. Install the control wires to the correct terminal points and then reinstall the control module.

Electric Actuator Maintenance

Once the actuator has been properly installed, it requires no maintenance. The gear train has been lubricated and in most cases will never be opened.

Duty Cycle Definition

"Duty Cycle" means the starting frequency.
Formula: Running Time ÷ (Running Time + Rest Time) x 100% = duty cycle
-> Rest Time = Running Time x (1 - duty cycle) ÷ duty cycle

For example: The running time is 15 seconds

30% duty cycle 15 x [(1 - 30%) / 30%] = 35 → The rest time will be 35 seconds 75% duty cycle 15 x [(1 - 75%) / 75%] = 5 → The rest time will be 5 seconds

If the duty cycle is higher, the rest time will be shortened, which means the starting frequency will be higher.

Thermal Overload

All actuators are equipped with thermal overload protection to guard the motor against damage due to overheating.

Mechanical Overload

All actuators are designed to withstand stall conditions. It is not recommended to subject the unit to repeated stall conditions.

Explosion-Proof Electric Actuators

WARNING 1. DO NOT under any circumstances remove the cover of the actuator while in a hazardous location. Removal of the cover while in a hazardous location could cause ignition of hazardous atmospheres.

 DO NOT under any circumstances use an explosion-proof electric actuator in a hazardous location that does not meet the specifications for which the actuator was designed.

3. Always verify that all electrical circuits are de-energized before opening the actuator.

4. Always mount and cycle test the actuator on the valve in a non-hazardous location.

5. When removing the cover, care must be taken not to scratch, scar of deform the flame path of the cover and base of the actuator, since this will negate the NEMA rating of the enclosure.

6. When replacing the cover, take care that the gasket is in place to assure proper clearance after the cover is secured.

7. All electrical connections must be in accordance with the specifications for which the unit is being used.

8. Should the unit ever require maintenance, remove from the hazardous location before attempting to work on the unit.

If the actuator is in a critical application, it is advisable to have a standby unit in stock.

Electric Actuators Performance Rating

TD01				
Voltage	110 VAC	220 VAC	24 VAC	24 VDC
Cycle Time	4 s	4 s	4 s	4 s
Duty Cycle (Two-Position)	85%	85%	85%	85%
AMP Draw	0.24 A	0.16 A	0.28 A	1.28 A
Torque	177 in-lb	177 in-lb	177 in-lb	177 in-lb

MD01			
Voltage	110 VAC	220 VAC	24 VAC
Cycle Time	10 s	10 s	10 s
MD01 Duty Cycle (Modulating)	85%	85%	85%
AMP Draw	0.24 A	0.16 A	1.28 A
Torque	265 in-lb	265 in-lb	265 in-lb

TD02 and MD02 (MD Not Available in 24 VDC)							
Voltage	110 VAC	220 VAC	24 VAC	24 VDC			
Cycle Time	20 s	20 s	20 s	20 s			
Duty Cycle (Two-Position)	85%	85%	85%	85%			
Duty Cycle (Modulating)	85%	85%	85%	-			
AMP Draw	0.24 A	0.16 A	1.28 A	1.28 A			
Torque	442 in-lb	442 in-lb	442 in-lb	442 in-lb			

TD03 and MD03 (MD Not Available in 24 VDC)							
Voltage	110 VAC	220 VAC	24 VAC	24 VDC			
Cycle Time	30 s	30 s	30 s	30 s			
Duty Cycle (Two-Position)	85%	85%	85%	85%			
Duty Cycle (Modulating)	85%	85%	85%	-			
AMP Draw	0.57 A	0.35 A	2.03 A	2.03 A			
Torque	885 in-lb	885 in-lb	885 in-lb	885 in-lb			

TD04 and MD04 (MD Not Available in 24 VDC)							
Voltage	110 VAC	220 VAC	24 VAC	24 VDC			
Cycle Time	30 s	30 s	30 s	30 s			
Duty Cycle (Two-Position)	85%	85%	85%	85%			
Duty Cycle (Modulating)	85%	85%	85%	-			
AMP Draw	0.65 A	0.37 A	3.57 A	3.57 A			
Torque	1770 in-lb	1770 in-lb	1770 in-lb	1770 in-lb			

TD05 and MD05 (MD Not Available in 24 VDC)							
Voltage	110 VAC	220 VAC	24 VAC	24 VDC			
Cycle Time	30 s	30 s	30 s	30 s			
Duty Cycle (Two-Position)	85%	85%	85%	85%			
Duty Cycle (Modulating)	85%	85%	85%	-			
AMP Draw	1.12 A	0.57 A	5.13 A	5.13 A			
Torque	3540 in-lb	3540 in-lb	3540 in-lb	3540 in-lb			

TD06 and MD06 (MD Not Available in 24 VDC)							
Voltage	110 VAC	220 VAC	24 VAC	24 VDC			
Cycle Time	45 s	45 s	45 s	45 s			
Duty Cycle (Two-Position)	85%	85%	85%	85%			
Duty Cycle (Modulating)	85%	85%	85%	-			
AMP Draw	1.18 A	0.60 A	6.04 A	6.04 A			
Torque	5210 in-lb	5210 in-lb	5210 in-lb	5210 in-lb			

TI01				
Voltage	110 VAC	220 VAC	24 VAC	24 VDC
Cycle Time	2.5 s	2.5 s	2.5 s	2.5 s
Duty Cycle (Two-Position)	25%	25%	25%	25%
Full Load AMP Draw	0.64	0.32	0.4	0.4
Torque (in-lb)	100	100	100	100

TI02 and MI01, MI02				
Voltage	110 VAC	220 VAC	24 VAC	24 VDC
Cycle Time (Two-Position)	5 s	5 s	5 s	5 s
Cycle Time (Modulating)	10 s	10 s	5 s	5 s
Duty Cycle (Two-Position)	25%	25%	25%	25%
Duty Cycle (Modulating)	75%	75%	75%	75%
Full Load AMP Draw	0.38	0.18	0.7	0.7
Torque (in-lb)	200	200	200	200

TI03 and MI03				
Voltage	110 VAC	220 VAC	24 VAC	24 VDC
Cycle Time (Two-Position)	5 s	5 s	5 s	5 s
Cycle Time (Modulating)	10 s	10 s	5 s	5 s
Duty Cycle (Two-Position)	25%	25%	25%	25%
Duty Cycle (Modulating)	75%	75%	75%	75%
Full Load AMP Draw	0.38	0.18	0.7	0.7
Torque (in-lb)	300	300	300	300

TI04 and MI04						
Voltage	110 VAC	220 VAC	24 VAC	24 VDC		
Cycle Time (Two-Position)	10 s	10 s	10 s	10 s		
Cycle Time (Modulating)	20 s	20 s	10 s	10 s		
Duty Cycle (Two-Position)	25%	25%	25%	25%		
Duty Cycle (Modulating)	75%	75%	75%	75%		
Full Load AMP Draw	0.38	0.18	0.9	0.9		
Torque (in-lb)	400	400	400	400		

TI05 and MI05						
Voltage	110 VAC	220 VAC	24 VAC	24 VDC		
Cycle Time (Two-Position)	15 s	15 s	15 s	15 s		
Cycle Time (Modulating)	30 s	30 s	15 s	15 s		
Duty Cycle (Two-Position)	25%	25%	25%	25%		
Duty Cycle (Modulating)	75%	75%	75%	75%		
Full Load AMP Draw	0.38	0.18	0.7	0.7		
Torque (in-lb)	675	675	675	675		

MAINTENANCE/REPAIR

Upon final installation of the Series WE, only routine maintenance is required. The Series WE is not field serviceable and should be returned if repair is needed. Field repair should not be attempted and may void warranty.

WARRANTY/RETURN

Refer to "Terms and Conditions of Sale" in our catalog and on our website. Contact customer service to receive a Return Goods Authorization number before shipping the product back for repair. Be sure to include a brief description of the problem plus any additional application notes

©Copyright 2015 Dwyer Instruments, Inc.

W.E. ANDERSON A DIVISION OF DWYER INSTRUMENTS, INC. P.O. BOX 373 • MICHIGAN CITY, INDIANA 46360, U.S.A. Phone: 219

Phone: 219/879-8000 Fax: 219/872-9057 FR# 444171-00 Rev. 11

www.dwyer-inst.com e-mail: info@dwyermail.com

10 Printed in U.S.A. 10/15